

The current limit is working and the voltage on the SS pin is dropping.

However, when going into sleep mode, the SS pin is not discharged, but is charged.

Also, the voltage drop time of the SS pin is set to 47.5ms, but it takes about 100ms.

Please tell me the reason why this phenomenon occurs and what to do about it.

## 【schematic】

Vin=330V

Fsw=150kHz

Vout=48V

Css=1uF


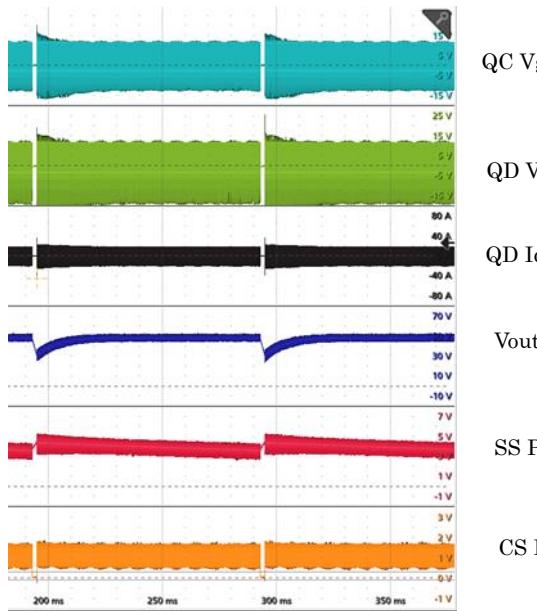


Fig.1 Start up operation

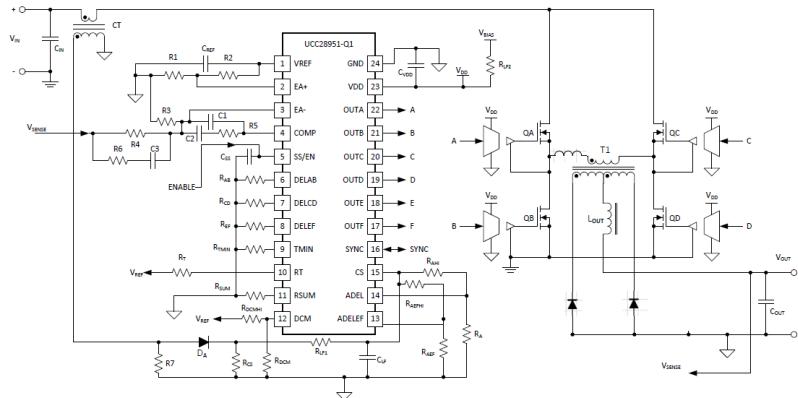